## 2009 International Building Code Errata

## **SECOND PRINTING (Updated March 22, 2010)**

## CHAPTER 30 ELEVATOR AND CONVEYING SYSTEMS

**3007.4.3 Lobby doorways.** Each fire service access elevator lobby shall be provided with a doorway that is protected with a 3/4-hour fire door assembly complying with Section 715.4. The fire door assembly shall also comply with the smoke and draft control door assembly requirements of Section 715.4.3.1 with the UL 1784 test conducted without the artificial bottom seat seal.

**3008.11 Occupant evacuation elevator lobby.** The occupant evacuation elevators shall open into an elevator lobby in accordance with Sections 3008.11.1 through 3008.11.4 3008.11.5.

**3008.11.2 Lobby enclosure.** The occupant evacuation elevator lobby shall be enclosed with a *smoke barrier* having a minimum 1-hour *fire-resistance rating*, except that lobby doorways shall comply with Section 3008.11.3 3008.11.5. **Exception:** Enclosed occupant evacuation elevator lobbies are not required at the level(s) of *exit discharge*.